


## Barracuda - BC 630 Upgrade

When re-assembling the **Barracuda** internal parts, after overhaul, a minor positioning error can result in failure of the centrifugal rotation speed control. If the **BC 315 Spring** comes loose at either end, it can damage the **BC 001 Shaft** and **BC 230 Sleeve**. It can also break in the process. Changes made include new springs with 90° bend at each end, so that they fit securely into a new hole/slot in the shaft and weights. The new design parts are installed in serial number 920 and higher. The new **BC 630 Upgrade Kit** fixes the problem in all old-design **Barracudas**. Included in the kit are a new shaft, weight set, spring, and bronze sleeve.

The **BC 630 Upgrade Kit** is priced at \$ 351.22, less 50% discount for a limited period of time. This discount expires October 1, 2002. Customers wishing to return their **Barracuda's** to StoneAge for the upgrade will be charged the discounted price for the kit (if before October 1, 2002), plus labor and other parts found necessary to replace. Old design parts ( **BC 001**, **BC 220**, and **BC 315**) will no longer be stocked. Any repairs needing these parts will require the entire **BC 630 Upgrade Kit**.

We hope you will take full advantage of the promotional discount, so that all your customers who bought old-design **Barracuda's** enjoy continued reliable performance. We ask your help to communicate this important program to your customers.

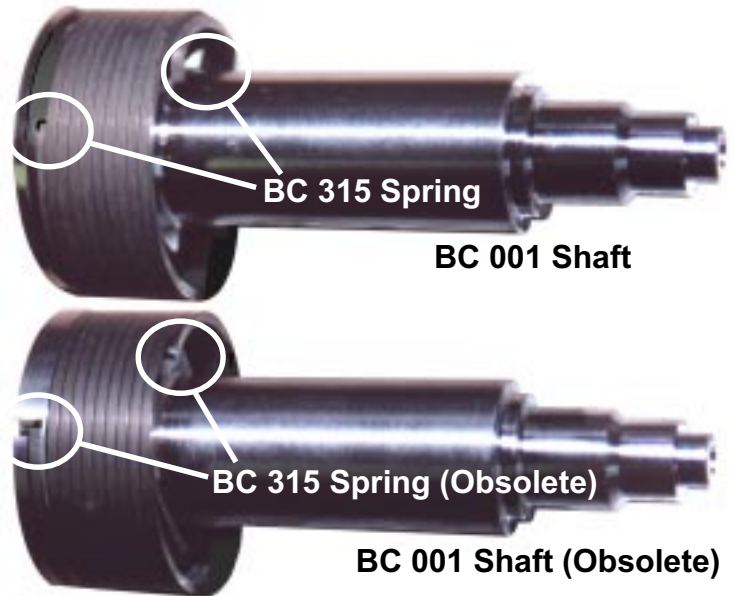

## Introducing Julie Frank

Julie Frank recently joined StoneAge, and will handle shipping. For quick service on shipment tracking, e-mail [julie@stoneagetools.com](mailto:julie@stoneagetools.com).



## NEW 40,000 psi Swivel



The new **UH-H6H9 Swivel** allows StoneAge rotary lancing systems to be up-rated from to 40,000 psi. Besides lancing systems, the new **UH-H6H9 Swivel** will be used for surface cleaners, air motor-driven rotary hose devices and rotary pipe cleaners.